

ASSEMBLY INSTRUCTION

rearTWIST BNC | 75Ω Cable Connector - Crimp version


Ⓐ
Ⓑ

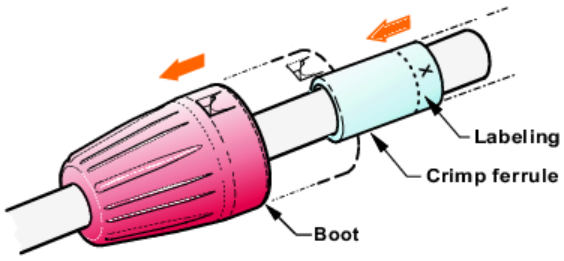

Ⓒ

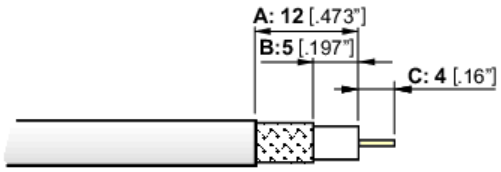

Ⓓ

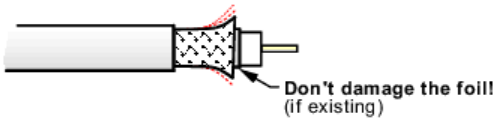

Ⓔ




Ⓐ Slide the boot onto the cable
- Position the labeling to the cabelend

Ⓑ Slide the crimp ferrule onto the cable

Ⓒ Prepare cable as shown
- Use an adjustable coaxial cable stripper

Ⓓ Spread the braided shield

(It`s easily with the NEUTRIK® "SHIELD-SPREADING-TOOL"!)

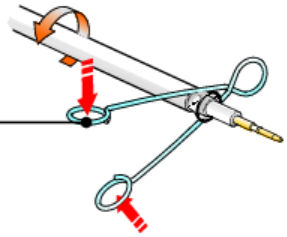


Ⓔ Crimp the pin
- position the pin on the center conductor
- Crimp the pin with the tool


(For best crimping-results it is recommended to use the original Neutrik crimp tool
- HXBNC with the corresponding insert
or hexcrimp acc. to IEC 803-W (SW 1.7)
or squarecrimp acc. to IEC 803-2 (SW 1.6)


- Pin can also be soldered (Optional)!
- Straighten the pin if misaligned.

Ⓕ Insert the cable into the connector body

Ⓖ Slide the crimp ferrule over the shield to the front and push the cable to it`s end position until you hear a snap noise.

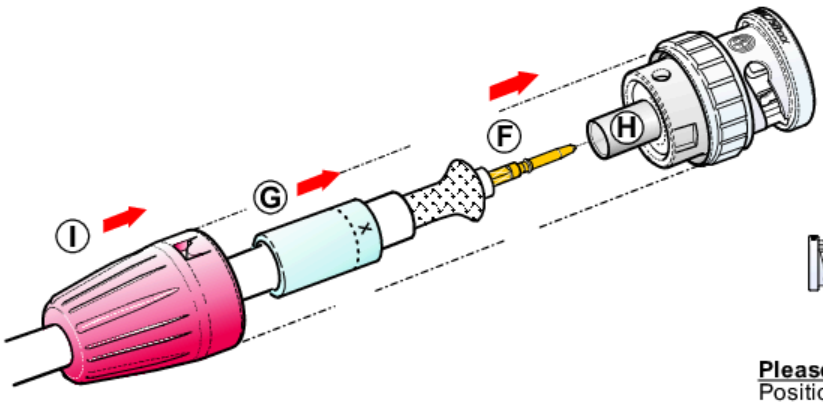


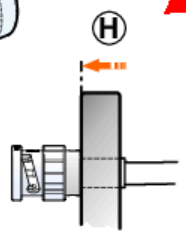

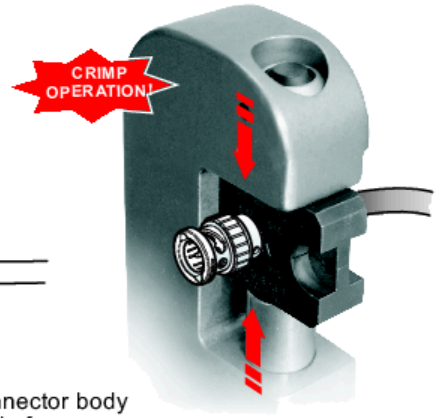

Please note:
Position the connector body
Flush with the die face.

Assembled Connector

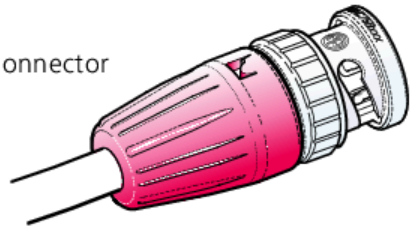

Ⓗ Crimp the ferrule with the tool

(For best crimping-results it is recommended to use the original Neutrik tool - HXBNC with the corresponding insert)

Ⓘ Snap the boot onto the connector body

NEUTRIK AG	**LI**	**T:** +423 / 237 24 24	**F:** +423 / 232 53 93	**NEUTRIK France**	**FR**	**T:** +33 1 / 4131 6750	**F:** +33 1 / 4131 0511
NEUTRIK USA Inc.	**USA**	**T:** +1 704 / 972 3050	**F:** +1 704 / 438 9202	**NEUTRIK Tokyo Ltd.**	**JP**	**T:** +81 3 / 3663 4733	**F:** +81 3 / 3663 4796
NEUTRIK (UK) Ltd.	**UK**	**T:** +44 1983 / 811 441	**F:** +44 1983 / 811 439	**NEUTRIK Hong Kong Ltd.**	**HK**	**T:** +852 / 2687 6055	**F:** +852 / 2687 6052
NEUTRIK Vertriebs GmbH	**DE/NL/AT/DK**	**T:** +49 8131 / 280 890	**F:** +49 8131 / 280 830				

Draft. Nr.: BDA 076 / 3102M0771 | **Update: 17.02.2012** |

Data subject to change without prior notice. ©2012 NEUTRIK®. ALL RIGHTS RESERVED. NEUTRIK® are registered trademark.

www.neutrik.com

NEUTRIK