

ASSEMBLY INSTRUCTION

rearTWIST BNC | 75Ω Cable Connector - Crimp version

Ⓐ
Ⓑ

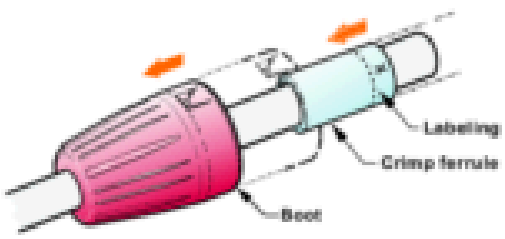

Ⓒ

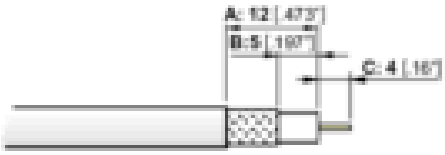

Ⓓ



Ⓔ



Ⓐ Slide the boot onto the cable
- Position the labeling to the cabelend

Ⓑ Slide the crimp ferrule onto the cable

Ⓒ Prepare cable as shown
- Use an adjustable coaxial cable stripper

Ⓓ Spread the braided shield



(It's easily with the NEUTRIK® "SHIELD-SPREADING-TOOL"!)


Ⓔ Crimp the pin
- position the pin on the center conductor
- Crimp the pin with the tool


(For best crimping-results it is recommended to use the original Neutrik crimp tool
- HXBNC with the corresponding insert
or hexcrimp acc. to IEC 803-W (SW 1.7)
or squarecrimp acc. to IEC 803-2 (SW 1.6)

- Pin can also be soldered (Optional)!
- Straighten the pin if misaligned.

Ⓕ Insert the cable into the connector body

Ⓖ Slide the crimp ferrule over the shield to the front and push the cable to it's end position until you hear a snap noise.

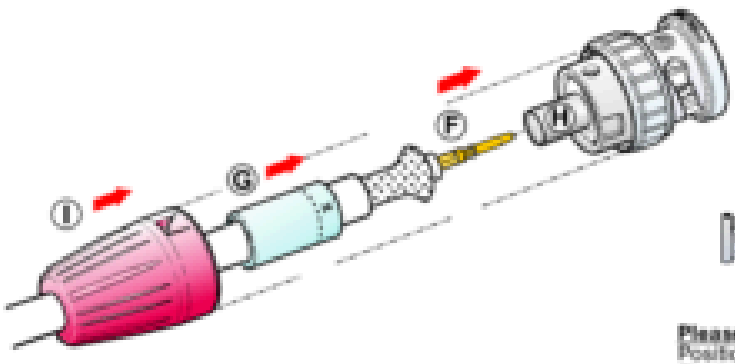

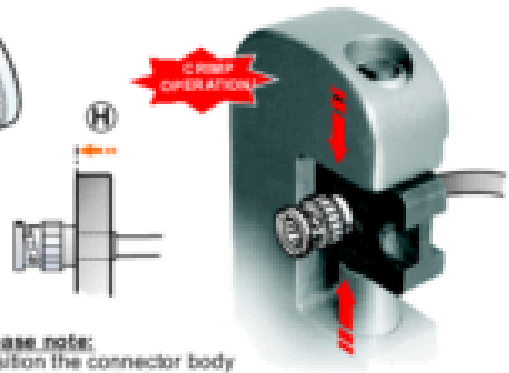

Please note:
Position the connector body Flush with the die face.

Assembled Connector



Ⓗ Crimp the ferrule with the tool

(For best crimping-results it is recommended to use the original Neutrik tool - HXBNC with the corresponding insert)

Ⓘ Snap the boot onto the connector body

NEUTRIK AG	LI	T: +423 / 237 34 34	F: +423 / 232 53 93
NEUTRIK USA Inc.	USA	T: +1 704 / 972 3050	F: +1 704 / 430 9202
NEUTRIK (UK) Ltd.	UK	T: +44 1883 / 611 441	F: +44 1883 / 611 439
NEUTRIK Vertriebs GmbH	DE/NL/AT/DK	T: +49 8131 / 280 890	F: +49 8131 / 280 830
NEUTRIK France	FR	T: +33 1 / 4131 6050	F: +33 1 / 4131 0511
NEUTRIK Tokyo Ltd.	JP	T: +81 3 / 3663 4733	F: +81 3 / 3663 4796
NEUTRIK Hong Kong Ltd.	HK	T: +852 / 2687 6055	F: +852 / 2687 6052

Draft. Nr.: BDA-016 / 31020607P1 | Update: 17.02.2012 |

Data subject to change without prior notice. All © NEUTRIK®. All ® NEUTRIK®, "NEUTRIK" are registered trademarks.

www.neutrik.com

NEUTRIK